CATERPILLAR*

Service Information System

Previous Screen

Welcome: jordaj3

✓ Product: NO EQUIPMENT SELECTED Model: NO EQUIPMENT SELECTED Configuration: NO EQUIPMENT SELECTED

Technical Information Bulletin

Do Not Use Delayed Engine Shutdown Option on Certain TH3510D, TH357D and TH408D Telehandlers {7610, 7620}

Media Number -M0103551-00
Caterpillar: Confidential Yellow

Publication Date -20/02/2019

Date Updated -20/02/2019

i07684113

Do Not Use Delayed Engine Shutdown Option on Certain TH3510D, TH357D and TH408D Telehandlers {7610, 7620}

SMCS - 7610; 7620

Telehandler

TH3510D (S/N: TH21-UP) TH357D (S/N: TD61-UP) TH408D (S/N: TH91-UP)

Introduction

The problem that is identified below does not have a known permanent solution. Until a permanent solution is known, use the solution that is identified below.

Problem

The delayed engine shutdown option is selectable through CAT[®] Electronic Technician (ET). But this action is not recommended to cool the Selective Catalyst Reduction (SCR) intake system on the machines listed above.

Solution



Illustration 1 g06395386

CAT® ET screen

Do not change the factory setting of "Disabled" as this may lead the engine to run up to 15 minutes with no chance of emergency shutdown.

The delayed shutdown cooling method is not required as the D-series Diesel Exhaust Fluid (DEF) injector is DEF cooled so that the SCR system will not be damaged.

Copyright 1993 - 2021 Caterpillar Inc. All Rights Reserved. Private Network For SIS Licensees.

Tue Feb 23 2021 18:28:38 GMT+0000 (Greenwich Mean Time)