

SMCS - 7312

Telehandler

TH3510D (S/N: TH21-326)

TH357D (S/N: TD61-830; TD71-173)

TH408D (S/N: TH41-185; TH91-1138)

Description Of Change: New switch kit for the suspension seat group is now used on the machines listed above. The new switch kit is more reliable.

Adaptable To: The following changes are adaptable to the products within the listed serial numbers, and are effective with all products after the listed serial numbers.

⚠ WARNING

Do not operate or work on this product unless you have read and understood the instructions and warnings in the relevant Operation and Maintenance Manuals and relevant service literature. Failure to follow the instructions or heed the warnings could result in injury or death. Proper care is your responsibility.


Required Part			
Item	Qty	New Part Number	Part Name
1	1	627-9841	Switch Kit

Table 1


Replace the existing switch kit with new part number listed in Table 1.

Note: Replace the existing switch kit which has etched design, no green dot, and date code of 2001/8 to 2030/8. Hence the period would be between week 01 and week 30 of the year 2020.


Follow the below steps to replace the existing switch kit:

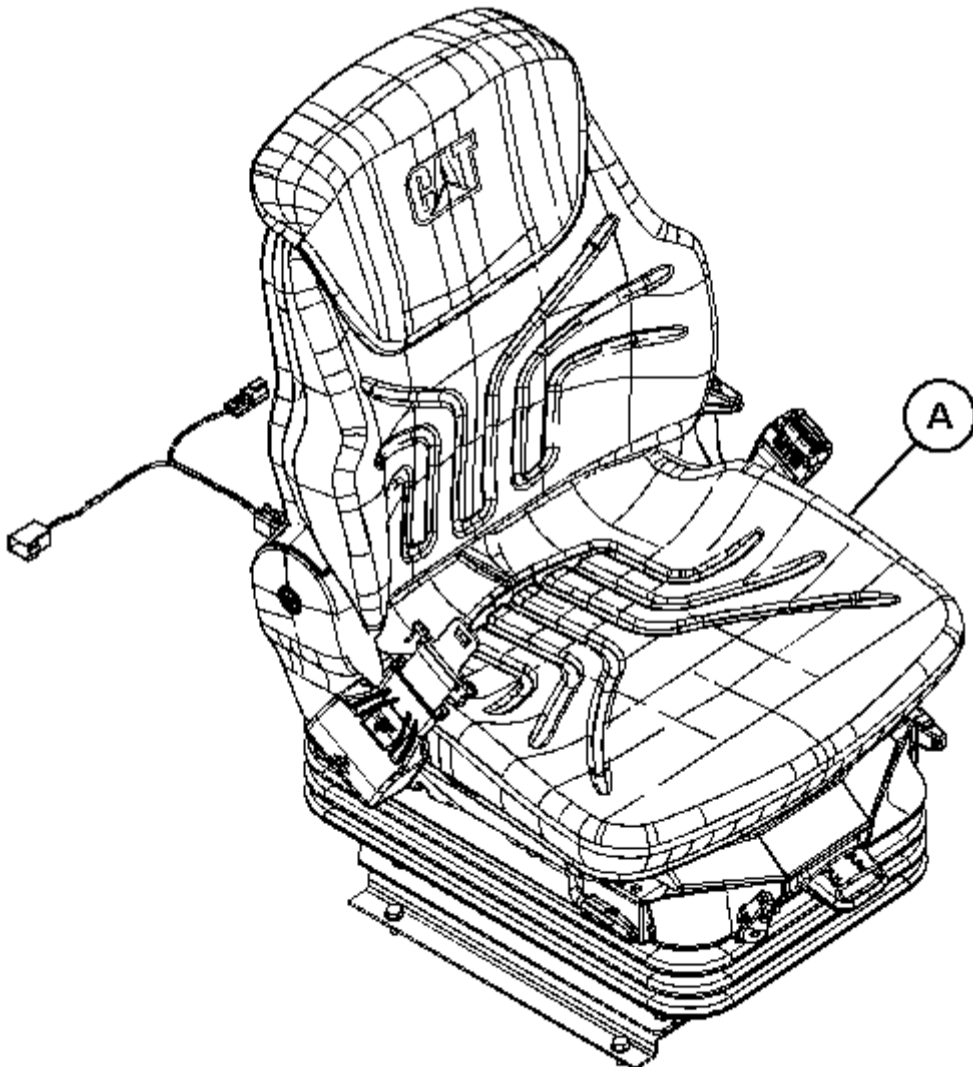

1. Remove and retain seat cushion (A).

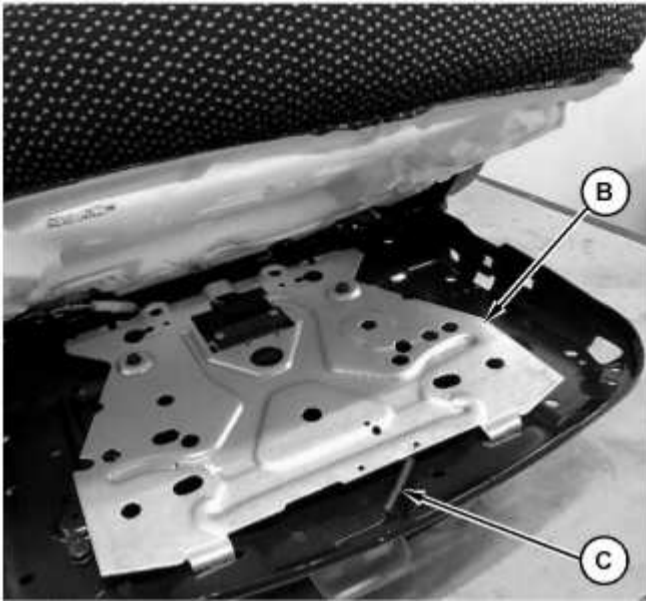

2. Release spring (C) from silver plate (B). Remove and retain silver plate (B) to access the switch kit.

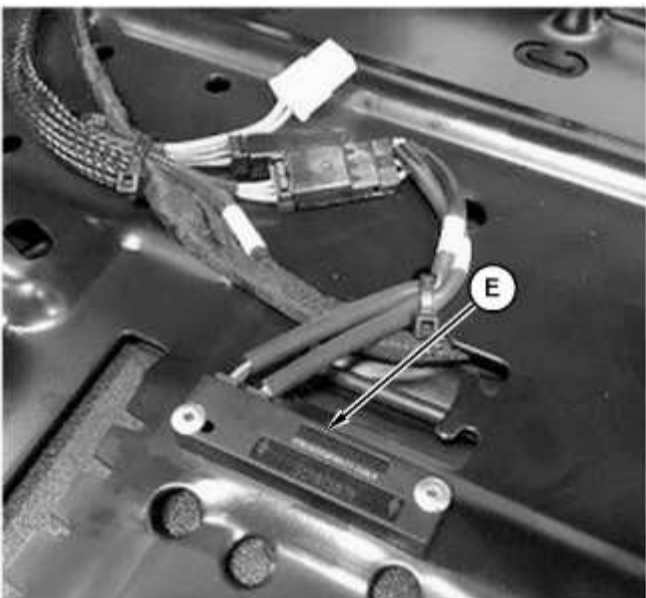

3. Remove and discard existing switch kit (E).



Illustration 5
View of area D
(1) 627-9841 Switch Kit

g07518312

4. Install new switch kit (1).

PIP-10087702

2022/09/27

15:50:23+01:00

i09596752

© 2022 Caterpillar Inc.

Caterpillar:

Confidential Green

PIP-10087702
2022/09/27
15:50:29+01:00
M0155