



## IMPORTANT SAFETY INFORMATION

July, 2004

Dear Valued Customer:

Our records indicate that you are a registered owner of a Graco Travel Lite Swing or that you have called Graco's customer service number regarding this product. We hope that the Travel Lite Swing has served you well.

This notice is sent to you in cooperation with the U.S. Consumer Product Safety Commission. Graco Children's Products is announcing the availability of a free upgrade kit for its Travel Lite Swing models 1850JJP, 1850JGB and 1870DAL manufactured from May 5, 2003 through December 11, 2003. The carrying handles may fail to stay in place and may drop or be pushed down, possibly hitting the child in the head; the 3-point seatbelt may not prevent the child from leaning/falling forward or to either side allowing the child's head to possibly strike the floor or the swing/seat frame.

To check if your Travel Lite Swing is affected, check your unit for missing parts as shown on the next page. Once this inspection has been completed, and all components are present, you can continue to use the swing. If you find that either of these two components are missing, DO NOT use your Travel Lite Swing and call Graco at 1-800-345-4109 to obtain a free upgrade kit consisting of a handle bracket kit and a seat pad with 5-point harness.

We apologize for this inconvenience and thank you for choosing Graco Children's Products. If you have any additional questions, please contact Graco at 1-800-345-4109.


**FOLLOW THESE INSTRUCTIONS TO DETERMINE IF YOUR TRAVEL SWING IS AFFECTED.**

PLEASE NOTE: All affected model numbers listed may also begin with the letter "A or B".


**MODEL NUMBERS AFFECTED: 1850JJP, 1850JGB and 1870DAL**

Inspect your swing for the red handle release button and 5 point harness with shoulder straps. If your model is missing either of these two components, **STOP** using your TravelLite Swing and please contact Graco Children's Products to receive a new seat pad with 5 point harness and a handle bracket kit.

**CORRECT MODEL**

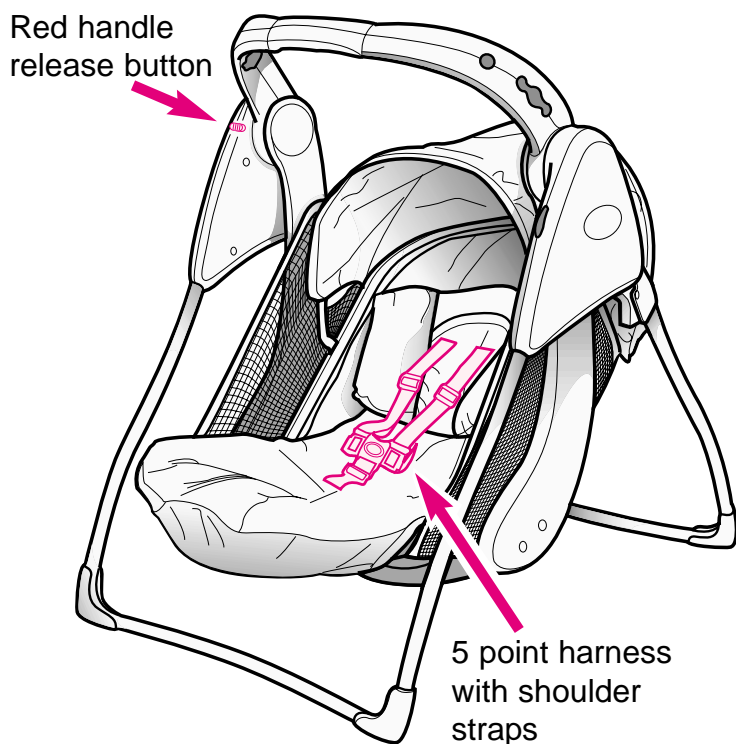

**INCORRECT MODEL**

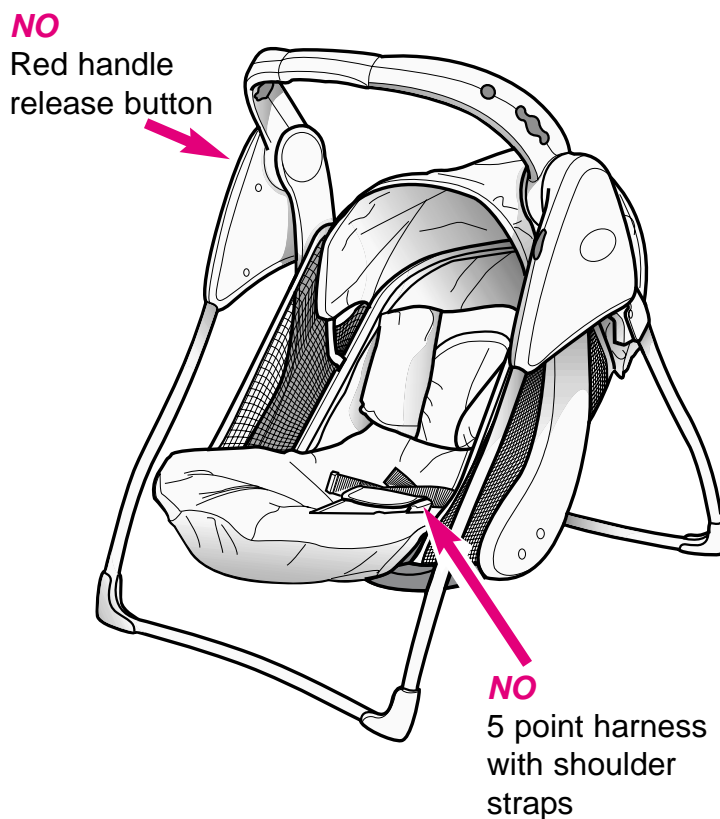

After inspection has been completed and your model has the red handle release button and 5 point harness with shoulder straps you may continue to enjoy using your Travel Lite swing.

If you do not understand these instructions or require additional assistance, please call 1-800-345-4109.